



Cisco RF Gateway 1 Software Release Notes, Release 2.02.16

Overview

Introduction

Software Release 2.02.16 contains enhancements enabling stream support for up to 32 PIDs and allowing pass through of non-remapped MPTS streams (with more than 32 PIDs). Release 2.02.16 retains DVB Simulcrypt Scrambling capability for the RF Gateway 1 platform and supports license-upgradeable data features and a user authentication feature for security of the RF Gateway 1 management interface.

Purpose

The purpose of this document is to notify RF Gateway 1 users of the enhancements included in the current release and inform users of any special upgrade procedures needed for using Release 2.02.16

Audience

This document is intended for system engineers or managers responsible for operating and/or maintaining this product.

Related Publications

Refer to the following documents for additional information regarding hardware and software.

- *Cisco RF Gateway 1 Configuration Guide*, part number 4025112
- *Cisco RF Gateway 1 System Guide*, part number 4024958

Safe Operation for Software Controlling Optical Transmission Equipment

If this document discusses software, the software described is used to monitor and/or control ours and other vendors' electrical and optical equipment designed to transmit video, voice, or data signals. Certain safety precautions should be observed when operating equipment of this nature.

For equipment specific safety requirements, refer to the appropriate section of the equipment documentation.

For safe operation of this software, refer to the following warnings.



WARNINGS:

- Ensure that all optical connections are complete or terminated before using this equipment to remotely control a laser device. An optical or laser device can pose a hazard to remotely located personnel when operated without their knowledge.
- Allow only personnel trained in laser safety to operate this software. Otherwise, injuries to personnel may occur.
- Restrict access of this software to authorized personnel only.
- Install this software in equipment that is located in a restricted access area.

In This Document

■ Stream Management Enhancements.....	3
■ Miscellaneous Improvements	4
■ Known Issues	5
■ Licensing	6
■ Upgrade Information	7
■ IP Port Configuration Changes.....	8
■ Upgrade Procedure for Customers Running 1.02.09.....	9
■ IP Port Configuration Parameter Settings.....	11
■ For Information.....	13

Stream Management Enhancements

The following miscellaneous bugs have been addressed in 2.02.16.

- Upon receiving streams with greater than 16 PIDs, the RF Gateway 1 was encountering issues resulting in a continuous reboot cycle. This is resolved with Release 2.02.16 where up to 32 PIDs are processed. When operating on non-remapped MPTS Pass-Through streams the RF Gateway 1 processes the input faithfully even for greater than 32 PIDs.
- The Advanced Settings page now allows choosing 16/32 PIDs per PMV (PID Multiplier Value). Refer to *Video Stream Map Configuration* in the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112.

The screenshot shows the 'Advanced Configuration' page with various settings. The 'Stream Map PIDs per PMV' setting is highlighted with a red box and is set to 32. Other settings include Dejitter Discontinuity Insertion (Disabled), Dejitter Discontinuity Persistence (Enabled), Dejitter Buffer Start Delay (0 milliseconds), Packet Delay Discontinuity Insertion (Disabled), Discontinuity Delay Threshold (5 milliseconds), Stream Hold Delay (2 seconds), Digicipher table change detection threshold (20), SI change detection threshold (6), and SI change detection interval (3 seconds). There are 'Apply' and 'Reset' buttons at the bottom.

Advanced Configuration	
Dejitter Discontinuity Insertion	Disabled
Dejitter Discontinuity Persistence	Enabled
Dejitter Buffer Start Delay	0 milliseconds
Packet Delay Discontinuity Insertion	Disabled
Discontinuity Delay Threshold	5 milliseconds
Stream Hold Delay	2 seconds
Digicipher table change detection threshold	20
SI change detection threshold	6
SI change detection interval	3 seconds
Stream Map PIDs per PMV	32

Apply Reset

Miscellaneous Improvements

The following miscellaneous improvements have been made in release 2.02.16.

- MPEG processing capabilities are now improved to accurately detect insufficient bandwidth.
- RF Gateway 1 system file download capabilities are improved to allow CRC checks.

Known Issues

The following list identifies known limitations planned to be resolved as part of an upcoming GA release.

- The RF Gateway 1 Web interface is not fully tested with IE-8 and FireFox-3.5 or newer. The RF Gateway 1 web management interface is tested with IE-6 or FireFox-2.0.0.14 and above. Use of Java 1.6.x is also recommended.
- The Summary page displays the unit rear panel with Conditional Access (CA) port enabled/ disabled as green/grey. The CA port indication represents the on/off setting and does not represent actual link status.



- The database Restore feature in 2.02.16 requires disabling trap settings (in the restore from database file prior to release 2.01.09) before starting the restore procedure. This can be done before starting a restore configuration in 2.02.16. The procedure is needed to allow compatibility with the enhanced SNMP version 1 and 2 trap support in 2.02.16.
- SNMP community strings are provided in 2.02.16 to support SNMP v1 and v2 traps. Prior to release 2.01.09, there was a single community string applicable to all five trap receivers configurable for the operator. In release 2.02.11 and beyond, in addition to supporting SNMPv1 and v2 traps, each of the five trap receivers has a separate configurable trap community string. This may cause a possible loss of SNMP trap community strings during an upgrade or downgrade procedure. An operator should carefully verify their trap community strings when upgrading to 2.02.11 or later releases or downgrading from 2.02.11 or later releases, if they are being used.
- An upgrade to 2.02.16 from pre-2.01.09 automatically enables insertion of the Network PID into the PAT. If this is an issue in the user's system, it may be disabled on the System/System Configuration page.

Licensing

After an upgrade to 2.02.16, a system license is required for the following features. Refer to Licensing in the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112.


- Data streams requiring use of the DOCSIS® Timing Interface
- DVB® Encryption

Most systems delivered with 1.02.20 or later using a data part number included a license file pre-installed at the factory. For these systems, an FTP transfer is not necessary.

All systems delivered prior to 1.02.20 and some systems delivered with 01.02.20 require a license file. This can be obtained from Cisco after an upgrade to 2.02.16. Contact your account representative for details on obtaining your license files.

Note: Performing an upgrade without a license file will generate an alarm, informing the user that a license file is not present. The unit continues to function until configuration changes are made. However, performing the upgrade may impact functionality of licensed features.

For systems requiring a license upgrade, a licensing capable RF Gateway 1 provides the operator with a new tree menu, located under the System tab, *License Management*. It provides an FTP mechanism to transfer license files to the device. It is recommended that the operator monitor the file transfer status using feedback from the FTP server.

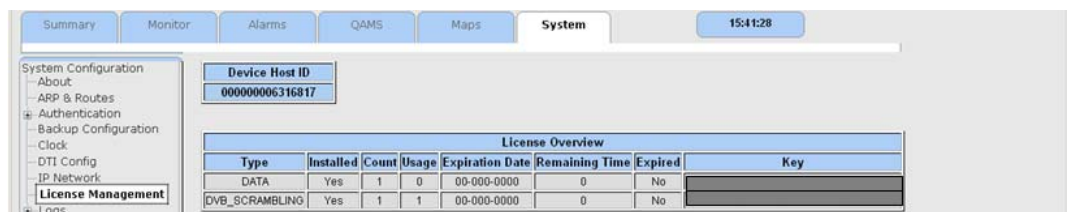

License Overview							
Type	Installed	Count	Usage	Expiration Date	Remaining Time	Expired	Key
DATA	Yes	1	0	00-000-0000	0	No	
DVB_SCRAMBLING	Yes	1	1	00-000-0000	0	No	

Upgrade Information

An RF Gateway 1 unit running release 1.02.20 can be upgraded directly to 2.02.16. Refer to Chapter 3, *General Configuration and Monitoring (Release Management)* of the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112, for more information. The RF Gateway 1 reboots automatically at the end of the upgrade process. However, when upgrading to 2.02.16 from 1.02.09, an intermediate step of using the bridge release 1.02.19 to arrive at 1.02.20 and finally 2.02.16 must be followed. The bridge release designated as 1.02.19 has been created to provide a secure and robust upgrade path. Releases 1.02.19 (bridge) and 1.02.20 (final) have identical user features and functionality. Refer to *Upgrade Procedure for Customers Running 1.02.09* (on page 9).

**WARNING:**

Upgrading to 1.02.20 or above directly from 1.02.09 must not be attempted. This may cause the RF Gateway 1 to be non-operational.

Refer to Known Issues (on page 5) for SNMP related upgrade, downgrade and database restore considerations.

IP Port Configuration Changes

There is a bug in 1.02.09 that causes the following IP port configuration parameters to have inverted values saved in the configuration file.

- Negotiation Mode (On/Off) - one for each port (total 4)
- Redundancy Mode (Auto/Manual) - one for each port pair (total 2)
- Revert Mode (Enable/Disable) - one for each port pair (total 2)

For details on these parameters, see Chapter 3, *General Configuration and Monitoring* of the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112.

This bug has been corrected in the configuration file in 1.02.19. Upon upgrade to 1.02.19, these three parameters will appear to have changed value as seen in the *System/IP Network* page of the web GUI. As a result, the IP ports may not be configured properly for operation immediately after upgrade (after the subsequent reboot that follows activation).

See *Upgrade Procedure for Customers Running 1.02.09* (on page 9).

Upgrade Procedure for Customers Running 1.02.09

**WARNING:**

Upgrading to 2.02.16 directly from 1.02.09 must not be attempted. This may cause the RF Gateway 1 to become non-operational.

- 1 Before starting the upgrade, backup the system configuration. Refer to Chapter 3, *General Configuration and Monitoring (Configuration Backup)* of the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112. Name the file appropriately to identify it as a configuration that corresponds to 1.02.09. This file will be necessary later if the user decides to revert back to 1.02.09.
- 2 Record the IP port configuration parameters by saving a screen capture of the *System/IP Network* page. Refer to **Recording IP Port Configuration Settings** (on page 12).
- 3 Download and activate 1.02.19. Refer to Chapter 3, *General Configuration and Monitoring (Release Management)* of the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112. The RF Gateway 1 reboots automatically at the end of the upgrade process.
- 4 After reboot, display the *System/IP Network* page. Refer to **Displaying IP Port Configuration Settings** (on page 11).
- 5 Verify the IP port configuration parameters by checking them against those recorded in step 2 (prior to the upgrade as done in step 3). The Negotiation Mode, Redundancy Mode, and Revert Mode parameter values are inverted. Refer to **Displaying IP Port Configuration Settings** (on page 11). Change the differing parameter values to match those recorded before download and activation. Be sure to click **Apply** after making your changes.
- 6 Once step 5 is completed, save the configuration which includes the IP port configuration parameters. Going forward, these values will not change.
- 7 Validate/qualify/soak release 1.02.19 in its application to establish confidence the release is operating at the same level as 1.02.09. In the very unlikely event service is impacted by 1.02.19, reverting back to 1.02.09 may be done to re-establish operations. If reverting back to 1.02.09 is necessary, the IP port configuration parameters must be swapped back and the configuration saved in step 2 restored.

Upgrade Procedure for Customers Running 1.02.09

- 8 After satisfactory completion of step 7, upgrade from 1.02.19 to 1.02.20. These two releases have identical performance and behavior. Release 1.02.20 includes a boot code upgrade that readily supports future roadmap features/releases without the need for subsequent two-step bridge upgrade processes.
- 9 Download and activate 2.02.16. Refer to Chapter 3, *General Configuration and Monitoring (Release Management)* of the *Cisco RF Gateway 1 Configuration Guide*, part number 4025112. The RF Gateway 1 reboots automatically at the end of the upgrade process.

IP Port Configuration Parameter Settings

See Chapter 3, *General Configuration and Monitoring of the Cisco RF Gateway 1 Configuration Guide*, part number 4025112 for specific details.

Displaying IP Port Configuration Settings

Follow these instructions to display the *System/IP Network* page.

- 1 Launch your web browser.
- 2 In the IP Address field, enter the RF Gateway 1 IP address.
- 3 Click **Enter**.
- 4 Click the *System/IP Network* tab and review the IP settings. See the following screen.

The screenshot displays the configuration page for 'rfgw1'. The left sidebar shows a navigation menu with 'IP Network' selected. The main content area is divided into two sections: '10/100 Ports' and 'GbE Input Ports'.

10/100 Ports Configuration:

	Management	Conditional Access
Port Control		Off
Address Selection Mode	Static	Static
MAC Address	00:50:4b:11:20:90	00:50:4b:11:20:90
IP Address	10.90.149.87	150.158.235.250
Subnet Mask	255.255.255.0	255.255.255.0
Default Gateway	10.90.149.1	150.158.235.254

GbE Input Ports Configuration:

	Port 1	Port 2	Port 3	Port 4
MAC Address	00:50:4b:11:20:98	00:50:4b:11:20:9f	00:50:4b:11:20:b0	00:50:4b:11:20:b1
IP Address	76.59.89.139	150.158.232.252	76.59.91.195	150.158.234.250
Subnet Mask	255.255.255.248	255.255.255.252	255.255.255.248	255.255.255.252
Negotiation Mode	On	On	On	On
Port Pair Configuration	Port Pair 1		Port Pair 2	
Video/Data IP	76.59.89.130		76.59.91.194	
Redundancy Mode	Manual		Manual	
Primary Port	1		3	
Current Active Port	1		3	
Detection Mode	Ethernet Link		Ethernet Link	
LOS Timeout (s)	1		1	
Revert To Primary	Enabled		Enabled	
Revert Check Time (s)	2		2	

Buttons for 'Apply' and 'Reset' are located at the bottom of the configuration area.

Recording IP Port Configuration Settings

Follow these instructions to record IP port configuration settings.

- 1 Navigate to the *System/IP Network* page.
- 2 Click the **Alt-PrtScrn** keys to copy the IP Network parameter settings to the clipboard.
- 3 Launch Microsoft Word (or WordPad if you don't have Microsoft Word) and paste the clipboard contents to page 1.
- 4 Save the Microsoft Word document as ipsettings.doc.

For Information

Support Telephone Numbers

This table lists the Technical Support and Customer Service numbers for your area.

Region	Centers	Telephone and Fax Numbers
North America	Cisco Services Atlanta, Georgia United States	For <i>Technical Support</i> , call: <ul style="list-style-type: none"> ■ Toll-free: 1-800-722-2009 ■ Local: 678-277-1120 (Press 2 at the prompt) For <i>Customer Service</i> , call: <ul style="list-style-type: none"> ■ Toll-free: 1-800-722-2009 ■ Local: 678-277-1120 (Press 3 at the prompt) ■ Fax: 770-236-5477 ■ Email: customer-service@cisco.com
Europe, Middle East, Africa	Belgium	For <i>Technical Support</i> , call: <ul style="list-style-type: none"> ■ Telephone: 32-56-445-197 or 32-56-445-155 ■ Fax: 32-56-445-061 For <i>Customer Service</i> , call: <ul style="list-style-type: none"> ■ Telephone: 32-56-445-444 ■ Fax: 32-56-445-051 ■ Email: service-elc@cisco.com
Japan	Japan	<ul style="list-style-type: none"> ■ Telephone: 81-3-5908-2153 or +81-3-5908-2154 ■ Fax: 81-3-5908-2155
Korea	Korea	<ul style="list-style-type: none"> ■ Telephone: 82-2-3429-8800 ■ Fax: 82-2-3452-9748 ■ Email: songk@cisco.com
China (mainland)	China	<ul style="list-style-type: none"> ■ Telephone: 86-21-2401-4433 ■ Fax: 86-21-2401-4455 ■ Email: xishan@cisco.com
All other Asia Pacific countries & Australia	Hong Kong	<ul style="list-style-type: none"> ■ Telephone: 852-2588-4746 ■ Fax: 852-2588-3139 ■ Email: saapac-support@cisco.com
Brazil	Brazil	<ul style="list-style-type: none"> ■ Telephone: 11-55-08-9999 ■ Fax: 11-55-08-9998 ■ Email: fattinl@cisco.com or ecavalhe@cisco.com
Mexico, Central America, Caribbean	Mexico	For <i>Technical Support</i> , call: <ul style="list-style-type: none"> ■ Telephone: 52-3515152599 ■ Fax: 52-3515152599 For <i>Customer Service</i> , call: <ul style="list-style-type: none"> ■ Telephone: 52-55-50-81-8425 ■ Fax: 52-55-52-61-0893 ■ Email: sa-latam-cs@cisco.com

For Information

Region	Centers	Telephone and Fax Numbers
All other Latin America countries	Argentina	For <i>Technical Support</i> , call: <ul style="list-style-type: none">■ Telephone: 54-23-20-403340 ext 109■ Fax: 54-23-20-403340 ext 103 For <i>Customer Service</i> , call: <ul style="list-style-type: none">■ Telephone: 770-236-5662■ Fax: 770-236-5888■ Email: keillov@cisco.com



5030 Sugarloaf Parkway, Box 465447
Lawrenceville, GA 30042

678.277.1000

Cisco, Cisco Systems, the Cisco logo, the Cisco Systems logo are registered trademarks or trademarks of Cisco Systems, Inc. and/or its affiliates in the U.S. and certain other countries. DOCSIS is a registered trademark of Cable Television Laboratories, Inc.

DVB is a registered trademark of the DVB project.

All other trademarks mentioned in this document are the property of their respective owners.

Product and service availability are subject to change without notice.

© 2010 Cisco Systems, Inc. All rights reserved.
January 2010

Printed in United States of America
Part Number 7019936 Rev A