

NCS5500 SATA FPD ne met pas à niveau avec mise à niveau automatique FPD

Contenu

[Introduction](#)

[NCS5500 SATA FPD ne met pas à niveau avec mise à niveau automatique FPD](#)

Introduction

Ce document décrit les problèmes qui se produisent lorsque le périphérique programmable de terrain (FPD) SATA (Serial ATA) Network Convergence System 5500 (NCS5500) n'effectue pas de mise à niveau avec la mise à niveau FPD automatique. Lorsque vous effectuez une mise à niveau vers les versions 6.3.3/6.5.1/7.0.1 ou ultérieures d'une version antérieure et que vous utilisez la fonctionnalité de mise à niveau automatique, il se peut que certains lecteurs de certaines cartes ne soient pas mis à niveau.

Il commence à partir des versions susmentionnées. La fonctionnalité de mise à niveau SATA FPD a été ajoutée avec une nouvelle version du micrologiciel pour certains types SATA (Micron). Dans le cas de ces versions, la nouvelle version est 5.00 alors que la version 3.00 était l'ancienne version FPD.

NCS5500 SATA FPD ne met pas à niveau avec mise à niveau automatique FPD

Voici les étapes à suivre pour reproduire le problème et comment mettre à niveau le SATA. Notez qu'il n'est pas nécessaire de recharger la carte après avoir mis à niveau son FPD.

```
sysadmin-vm:0_RP0(config)# fpd auto-upgrade enable
sysadmin-vm:0_RP0(config)# commit
Wed Sep 12 15:57:26.892 UTC
Commit complete.
sysadmin-vm:0_RP0(config)# exit
Wed Sep 12 15:57:28.187 UTC
sysadmin-vm:0_RP0# exit
Wed Sep 12 15:57:30.101 UTC
RP/0/RP0/CPU0:router#conf t
Wed Sep 12 10:57:32.154 CDT
RP/0/RP0/CPU0:router(config)#fpd auto-upgrade enable
RP/0/RP0/CPU0:router(config)#commit
```

<après l'installation, activez et rechargez>

RP/0/RP0/CPU0:router#show hw-module fpd
Wed Sep 12 11:51:32.195 CDT

Location	Card type	HWver	FPD device	ATR Status	FPD Versions	
					Running	Programd
0/0	NC55-36X100G-S	1.2	MIFPGA	CURRENT	0.07	0.07
0/0	NC55-36X100G-S	1.2	Bootloader	CURRENT	1.13	1.13
0/0	NC55-36X100G-S	1.2	IOFPGA	CURRENT	0.11	0.11
0/0	NC55-36X100G-S	1.2	SATA	NEED UPGD	3.00	3.00
0/RP0	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP0	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/RP1	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP1	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/FC0	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC0	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC1	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC1	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC2	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC2	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC3	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC3	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC5	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC5	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/SC0	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC0	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10
0/SC1	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC1	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10

RP/0/RP0/CPU0:router# admin
Wed Sep 12 11:51:54.259 CDT

admin connected from 127.0.0.1 using console on router

sysadmin-vm:0_RP1# upgrade hw-module location 0/0 fpd ?
Possible completions:

Bootloader IOFPGA SATA all

sysadmin-vm:0_RP1# upgrade hw-module location 0/0 fpd all
Wed Sep 12 16:52:07.859 UTC

sysadmin-vm:0_RP1# 0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT : Upgrade for the following FPDs has been committed:

0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :
Location FPD name Force

0/RP1/ADMIN0:Sep 12 11:52:10.861 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :
=====

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :
0/0 SATA FALSE

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :
0/0 IOFPGA FALSE

0/RP1/ADMIN0:Sep 12 11:52:10.864 CDT: fpdserv[4429]: %INFRA-FPD_Manager-1-UPGRADE_ALERT :
0/0 Bootloader FALSE

0/0/ADMIN0:Sep 12 11:52:16.876 CDT: sata_fpd[3179]: %INFRA-FPD_Driver-1-UPGRADE_ALERT : FPD
SATA@0/0 image programming completed with UPGRADE DONE state Info: [SATA FPD upgrade Complete]

RP/0/RP0/CPU0:Sep 12 11:52:16.871 CDT: fpd-serv[427]: %PKT_INFRA-FM-3-FAULT_MAJOR : ALARM_MAJOR
:FPD-NEED-UPGRADE :CLEAR :0/0:

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1#

sysadmin-vm:0_RP1# exit

Wed Sep 12 16:52:27.767 UTC

RP/0/RP0/CPU0:router#show hw-module fpd

Wed Sep 12 11:52:33.810 CDT

FPD Versions
=====

Location	Card type	HWver	FPD device	ATR Status	Running Programd	
0/0	NC55-36X100G-S	1.2	MIFPGA	CURRENT	0.07	0.07
0/0	NC55-36X100G-S	1.2	Bootloader	CURRENT	1.13	1.13
0/0	NC55-36X100G-S	1.2	IOFPGA	CURRENT	0.11	0.11
0/0	NC55-36X100G-S	1.2	SATA	CURRENT	5.00	5.00
0/RP0	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP0	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/RP1	NC55-RP	1.1	Bootloader	CURRENT	9.25	9.25
0/RP1	NC55-RP	1.1	IOFPGA	CURRENT	0.09	0.09
0/FC0	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC0	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC1	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC1	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC2	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC2	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC3	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC3	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/FC5	NC55-5504-FC	1.0	Bootloader	CURRENT	1.75	1.75
0/FC5	NC55-5504-FC	1.0	IOFPGA	CURRENT	0.07	0.07
0/SC0	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC0	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10
0/SC1	NC55-SC	2.0	Bootloader	CURRENT	1.74	1.74
0/SC1	NC55-SC	2.0	IOFPGA	CURRENT	0.10	0.10